

EXPERT

Inspectors, Inc.

*Serving Florida's Condominium & Homeowner
Associations Since 2002*

Reserve Studies - Replacement Cost Valuations - Wind Storm Mitigations

Replacement Cost Valuation Prepared For:

Watermark Condominium Association

401 N. Atlantic Ave.

New Smyrna Beach, Florida 32169



**Date Of Site Visit:
August 2, 2022**



www.flinsurancevaluations.com

(386) 677-8886

(866) 480-8236

OFFICES

**Daytona Beach, West Palm Beach,
Coral Gables (Miami), St. Petersburg and Venice**

EXPERT INSPECTORS, INC.

Expert Inspectors, Inc. has been serving the needs of Florida Homeowner and Condominium Associations since 2002. We offer our services to the entire State. The company maintains an 'A' rating from the Better Business Bureau as well as membership in numerous Chambers of Commerce and numerous professional organizations.

Per your request an inspection of the property was completed to determine the cost to replace the structure, in its current condition, if a total loss was to occur. In the following pages you will find a detailed property valuation report using the CoreLogic valuation system and program and photographs of the property.

The intended user of this replacement cost report is the property owner or insured. The intended use is to evaluate the property, analyze and report the replacement cost for insurance purposes, excluding the site value, demolition cost, excavation, land improvements and equipment costs. The exclusions or additions are computed on the basis of items specifically included or excluded from the coverage by the policy and it's riders and endorsement. The additional expense incurred for demolition and/or debris removal is a paper cost of reconstruction and is the matter of the underwriting policy and has not been included in this Replacement Cost Report. This is not a real estate appraisal, but a replacement cost report utilizing the accepted CoreLogic insurance appraisal calculation system.

A traditional appraisal places a market resale value on a property - this is exclusively what it would cost to replace the structure.

COST APPROACH TO VALUE:

In the case of valuation for insurance purposes, there is no imputed depreciation, as the improvements, if destroyed would be replaced in full at the current value.

DEFINITION OF INSURABLE VALUE

The following definition is used for valuations:

1. The portion of the value or asset group that is acknowledged or recognized under the provisions of an applicable loss insurance industry.
2. Value used by insurance companies as the basis for insurance. Often considered to be replacement or reproduction cost less deterioration of non-insurable items.

Cost estimates are derived from CoreLogic software with the most recent updates available. Administrative and profit included in price per square foot estimates.



Watermark Condominium Association

401 N. Atlantic Ave, New Smyrna Beach, FL 32169



- Insurance Commercial Replacement Cost Valuation -

Property Overview:

A condominium association located oceanfront in New Smyrna Beach, Florida. The association has 4 structures - the 6 story tall condominium building, 2 detached garages and a pool bathroom building. In addition, there are several site additions on the property.

The condominium structure was built in 1980 and is of ISO6 (Reinforced Concrete Frame) construction. There is one elevator and the entire property has fire sprinkler system protection. The exterior wall are concrete block with stucco coverings. The roof is also concrete with a membrane covering.

Both garages and the pool bath building are of ISO2 (Joisted Masonry) construction. Both garages are of identical square footage, but the South garage also has a small sprinkler pump addition and the roof has solar panels for the pool.

<u>Building</u>	<u>Hazard/Wind</u>	<u>Flood</u>
1 - Watermark Condominium	\$ 7,903,788	\$10,330,754
2 - South Garage	\$ 308,298	\$ 332,962
3 - North Garage	\$ 293,448	\$ 328,662
4 - Pool Bathroom Bldg	\$ 71,995	\$ 82,794
TOTALS:	\$ 8,577,529	\$11,075,172

SITE ADDITIONS:

Tennis Court	\$ 30,942
Swimming Pool	\$ 72,293
Metal Fence - Rear Pool Area	\$ 38,880
Vinyl Fence - North Perimeter	\$ 17,442
Lights	\$ 2,970
Monument Sign w/lights	\$ 3,600
Landscaping Stone Wall - South	\$ 9,300
Pavers	\$ 16,500

Florida Replacement Cost Values: Over the last 5 years Florida has seen steady increases in the cost of construction (material and labor). This impacts new construction as well as and replacement values. The increase throughout Florida has averaged 4%-5% per year over the last several years. These vary slightly with the geographic location. However, both construction materials as well as labor costs have increased greatly in 2021 and is reflected in this report. The total cost increase in Florida for 2021 was 13.7-15.5%. Also, for structures located on barrier islands (with access only by bridge) the method of valuation has been modified. It now reflects the additional cost associated with transporting labor and materials to the location with longer and more limited access. This method more accurately estimates the correct replacement cost.

These insurance replacement valuation amounts are based on current market conditions for the geographic area where these structures are located. If an event of sufficient magnitude occurs in a large area and results in the destruction of these improvements, it is possible that debris removal and construction costs will spike upward at that time.



Valuation Standard Report

HAZARD/WIND Replacement Valuation

8/5/2022

VALUATION

Valuation Number:	ESTIMATE-0000891	Effective Date:	08/05/2022
Value Basis:	Reconstruction	Expiration Date:	08/05/2023
		Estimate Expiration Date:	11/03/2022
		Cost as of:	03/2022

BUSINESS

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

LOCATION 1 - Watermark Condominium Association

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

Location Adjustments

Climatic Region:	3 - Warm
High Wind Region:	2 - Moderate Damage
Seismic Zone:	1 - No Damage

BUILDING 1 - Watermark Condominium

Section 1

SUPERSTRUCTURE

Occupancy:	100% Condominium, w/o Interior Finishes	Story Height:	9 ft.
Construction Type:	100% Reinforced Concrete Frame (ISO 6)	Number of Stories:	6
Gross Floor Area:	52,188 sq.ft.	Irregular Adjustment:	None
Construction Quality:	2.0 - 2.0 - Average		
Year Built:	1980		

SUBSTRUCTURE

Other:	None (Remove Slab Cost)	52,188 sq.ft.
--------	-------------------------	---------------

Adjustments

Hillside Construction:	Degree of Slope: Level	Site Accessibility:	Fair
	Site Position: Unknown	Soil Condition:	Good

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

HAZARD/WIND Replacement Valuation

Policy Number: ESTIMATE-0000891

8/5/2022

Fees

Architect Fees: 7% is included
Overhead and Profit: 20% is included

SUMMARY OF COSTS	Reconstruction	Exclusion
SUPERSTRUCTURE		
Site Preparation	\$2,818	
Foundations	(\$264,525)	
Foundation Wall, Interior Foundations, Slab On Ground		
Exterior	\$3,106,549	
Framing, Exterior Wall, Exterior Wall, Structural Floor, Roof		
Interior	\$1,537,507	
Floor Finish, Ceiling Finish, Partitions		
Mechanicals	\$2,360,796	
Heating, Cooling, Fire Protection, Plumbing, Electrical, Elevators		
Built-ins	\$586,556	
SUBTOTAL RC	\$7,329,700	
ADDITIONS		
Building Items	\$574,088	
Total Additions	\$574,088	
TOTAL RC Section 1	\$7,903,788	
TOTAL RC BUILDING 1 Watermark Condominium	\$7,903,788	

BUILDING 2 - South Garage

Section 1

SUPERSTRUCTURE

Occupancy:	100% Parking on First Level	Story Height:	10 ft.
Construction Type:	100% Masonry (ISO 2)	Number of Stories:	1
Gross Floor Area:	4,600 sq.ft.	Irregular Adjustment:	None
Construction Quality:	2.0 - 2.0 - Average		
Year Built:	1980		

Adjustments

Hillside Construction:	Degree of Slope: Level	Site Accessibility:	Fair
	Site Position: Unknown	Soil Condition:	Good

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

HAZARD/WIND Replacement Valuation

Policy Number: ESTIMATE-0000891

8/5/2022

Fees

Architect Fees: 7% is included
Overhead and Profit: 20% is included

SUMMARY OF COSTS	Reconstruction	Exclusion
SUPERSTRUCTURE		
Site Preparation	\$1,376	
Foundations	\$1,335	
Foundation Wall, Interior Foundations, Slab On Ground		
Exterior	\$232,923	
Framing, Exterior Wall, Exterior Wall, Structural Floor, Roof		
Interior	\$5,272	
Floor Finish, Ceiling Finish, Partitions		
Mechanicals	\$25,457	
Heating, Cooling, Fire Protection, Plumbing, Electrical, Elevators		
Built-ins	\$27,085	
SUBTOTAL RC	\$293,448	
ADDITIONS		
Custom Items		
Sprinkler Housign/Pump		\$14,850
Total Additions	\$14,850	
TOTAL RC Section 1	\$308,298	
TOTAL RC BUILDING 2 South Garage	\$308,298	

BUILDING 3 - North Garage

Section 1

SUPERSTRUCTURE

Occupancy:	100% Parking on First Level	Story Height:	10 ft.
Construction Type:	100% Masonry (ISO 2)	Number of Stories:	1
Gross Floor Area:	4,600 sq.ft.	Irregular Adjustment:	None
Construction Quality:	2.0 - 2.0 - Average		
Year Built:	1980		

Adjustments

Hillside Construction:	Degree of Slope: Level	Site Accessibility:	Fair
------------------------	------------------------	---------------------	------

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

HAZARD/WIND Replacement Valuation

Policy Number: ESTIMATE-0000891

8/5/2022

Site Position: Unknown

Soil Condition:

Good

Fees

Architect Fees: 7% is included

Overhead and Profit: 20% is included

SUMMARY OF COSTS

Reconstruction Exclusion

SUPERSTRUCTURE

Site Preparation

\$1,376

Foundations

\$1,335

Foundation Wall, Interior Foundations, Slab On Ground

Exterior

\$232,923

Framing, Exterior Wall, Exterior Wall, Structural Floor, Roof

Interior

\$5,272

Floor Finish, Ceiling Finish, Partitions

Mechanicals

\$25,457

Heating, Cooling, Fire Protection, Plumbing, Electrical, Elevators

Built-ins

\$27,085

TOTAL RC Section 1

\$293,448

TOTAL RC BUILDING 3 North Garage

\$293,448

BUILDING 4 - Pool Bathroom Building

Section 1

SUPERSTRUCTURE

Occupancy: 100% Park Restroom Building

Story Height: 9 ft.

Construction Type: 100% Masonry (ISO 2)

Number of Stories: 1

Gross Floor Area: 350 sq.ft.

Irregular Adjustment: None

Construction Quality: 2.0 - 2.0 - Average

Year Built: 1981

Adjustments

Hillside Construction: Degree of Slope: Level

Site Accessibility: Fair

Site Position: Unknown

Soil Condition: Good

Fees

Architect Fees: 7% is included

Overhead and Profit: 20% is included

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

HAZARD/WIND Replacement Valuation

Policy Number: ESTIMATE-0000891

8/5/2022

SUMMARY OF COSTS		Reconstruction	Exclusion
SUPERSTRUCTURE			
Site Preparation		\$98	
Foundations		\$8,608	
Foundation Wall, Interior Foundations, Slab On Ground			
Exterior		\$29,482	
Framing, Exterior Wall, Exterior Wall, Structural Floor, Roof			
Interior		\$7,238	
Floor Finish, Ceiling Finish, Partitions			
Mechanicals		\$26,382	
Heating, Cooling, Fire Protection, Plumbing, Electrical, Elevators			
Built-ins		\$188	
TOTAL RC Section 1		\$71,995	
TOTAL RC BUILDING 4 Pool Bathroom Building		\$71,995	
	Reconstruction	Sq.Ft.	\$/Sq.Ft.
LOCATION SUBTOTAL (All Buildings)	\$8,577,530	61,738	\$139
LOCATION ADDITIONS			
Site Improvements	\$142,115		
Custom Items			
Swimming Pool Solar Panels	\$6,500		
Lights	\$2,970		
Monument Sign w/lights	\$3,600		
Pavers	\$16,500		
Stonewall - South side	\$9,300		
Location Additions Value	\$180,985		
LOCATION TOTAL, Location 1	\$8,758,514	61,738	\$142
	Reconstruction	Sq.Ft.	\$/Sq.Ft.
VALUATION GRAND TOTAL	\$8,758,514	61,738	\$142

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

HAZARD/WIND Replacement Valuation
EQUIPMENT REPORT

Policy Number: ESTIMATE-0000891

8/5/2022

VALUATION

Valuation Number:	ESTIMATE-0000891	Effective Date:	08/05/2022
Value Basis:	Reconstruction	Expiration Date:	08/05/2023
		Estimate Expiration Date:	11/03/2022
		Cost as of:	03/2022

BUSINESS

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

LOCATION 1 - Watermark Condominium Association

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

Equipment: Building items and site improvements

	Replacement	Depreciated
Building 1, Section 1		
Building Items		
Balconies		
(1) Balconies, Reinforced concrete frame	\$561,330	\$561,330
Canopies		
(1) Cast-in-Place Concrete w/Flat Plate Deck, Wall supported	\$12,758	\$12,758
Building 2, Section 1		
Custom Items		
(1) Sprinkler Housign/Pump	\$14,850	\$14,850
LOCATION 1 Additions		
Custom Items		
(1) Swimming Pool Solar Panels	\$6,500	\$6,500
(1) Lights	\$2,970	\$2,970
(1) Monument Sign w/lights	\$3,600	\$3,600
(1) Pavers	\$16,500	\$16,500
(1) Stonewall - South side	\$9,300	\$9,300
Site Improvements		
Fences		

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

HAZARD/WIND Replacement Valuation
EQUIPMENT REPORT

Policy Number: ESTIMATE-0000891

8/5/2022

Equipment: Building items and site improvements		
	Replacement	Depreciated
(1) Aluminized steel, 9 gauge wire	\$38,880	\$38,880
Swimming Pools		
(1) Cast-in-place concrete or gunite sprayed-on concre, 1,000 SF Water Surface Area	\$72,293	\$72,293
Tennis Courts		
(1) Tennis courts, Asphalt	\$30,942	\$30,942
LOCATION 1 - Watermark Condominium Association TOTAL	\$769,922	\$769,922
TOTAL	\$769,922	\$769,922

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

HAZARD/WIND Replacement Valuation
SUMMARY REPORT

Policy Number: ESTIMATE-0000891

8/5/2022

VALUATION

Valuation Number:	ESTIMATE-0000891	Effective Date:	08/05/2022
Value Basis:	Reconstruction	Expiration Date:	08/05/2023
		Estimate Expiration Date:	11/03/2022
		Cost as of:	03/2022

BUSINESS

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

LOCATION 1 - Watermark Condominium Association

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

BUILDING 1: SUPERSTRUCTURE			Reconstruction	Sq.Ft.	\$/Sq.Ft.
Section 1	100%	Condominium, w/o Interior Finishes	\$7,329,701	52,188	\$140
Section Totals			Reconstruction	Sq.Ft.	\$/Sq.Ft.
Section 1	100%	Condominium, w/o Interior Finishes	\$7,329,700	52,188	\$140
Total Additions:			\$574,088		
BUILDING TOTAL, Building 1			\$7,903,788	52,188	\$151

BUILDING INSURANCE SUMMARY

Total Insured Amount	\$0	
Percent of Insurance to Value	0%	
100% Co-insurance Requirement	\$7,903,788	\$7,903,788
-100% Variance	(\$7,903,788)	

BUILDING 2: SUPERSTRUCTURE			Reconstruction	Sq.Ft.	\$/Sq.Ft.
Section 1	100%	Parking on First Level	\$293,448	4,600	\$64
Section Totals			Reconstruction	Sq.Ft.	\$/Sq.Ft.
Section 1	100%	Parking on First Level	\$293,448	4,600	\$64
Total Additions:			\$14,850		
BUILDING TOTAL, Building 2			\$308,298	4,600	\$67

BUILDING INSURANCE SUMMARY

Total Insured Amount	\$0
----------------------	-----

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

HAZARD/WIND Replacement Valuation
SUMMARY REPORT

Policy Number: ESTIMATE-0000891

8/5/2022

Percent of Insurance to Value	0%	
100% Co-insurance Requirement	\$308,298	\$308,298
-100% Variance	(\$308,298)	

BUILDING 3: SUPERSTRUCTURE			Reconstruction	Sq.Ft.	\$/Sq.Ft.
Section 1	100%	Parking on First Level	\$293,448	4,600	\$64
Section Totals			Reconstruction	Sq.Ft.	\$/Sq.Ft.
Section 1	100%	Parking on First Level	\$293,448	4,600	\$64
BUILDING TOTAL, Building 3			\$293,448	4,600	\$64

BUILDING INSURANCE SUMMARY

Total Insured Amount	\$0	
Percent of Insurance to Value	0%	
100% Co-insurance Requirement	\$293,448	\$293,448
-100% Variance	(\$293,448)	

BUILDING 4: SUPERSTRUCTURE			Reconstruction	Sq.Ft.	\$/Sq.Ft.
Section 1	100%	Park Restroom Building	\$71,995	350	\$206
Section Totals			Reconstruction	Sq.Ft.	\$/Sq.Ft.
Section 1	100%	Park Restroom Building	\$71,995	350	\$206
BUILDING TOTAL, Building 4			\$71,995	350	\$206

BUILDING INSURANCE SUMMARY

Total Insured Amount	\$0	
Percent of Insurance to Value	0%	
100% Co-insurance Requirement	\$71,995	\$71,995
-100% Variance	(\$71,995)	

	Reconstruction	Sq.Ft.	\$/Sq.Ft.
LOCATION SUBTOTAL (All Buildings)	\$8,577,530	61,738	\$139
Total Location Additions	\$180,985		
LOCATION TOTAL, Location 1	\$8,758,514	61,738	\$142
	Reconstruction	Sq.Ft.	\$/Sq.Ft.
VALUATION GRAND TOTAL	\$8,758,514	61,738	\$142

End of Report

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

Property Express

8/5/2022

FLOOD Replacement Cost Valuation

VALUATION

Valuation Number:	ESTIMATE-0000891	Effective Date:	08/05/2022
Value Basis:	Reconstruction	Expiration Date:	08/05/2023
		Estimate Expiration Date:	11/03/2022
		Cost as of:	03/2022

BUSINESS

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

LOCATION 1 - Watermark Condominium Association

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

Location Adjustments

Climatic Region:	3 - Warm
High Wind Region:	2 - Moderate Damage
Seismic Zone:	1 - No Damage

BUILDING 1 - Watermark Condominium

Section 1

SUPERSTRUCTURE

Occupancy:	100% Condominium	Story Height:	9 ft.
Construction Type:	100% Reinforced Concrete Frame (ISO 6)	Number of Stories:	6
Gross Floor Area:	52,188 sq.ft.	Irregular Adjustment:	None
Construction Quality:	2.0 - 2.0 - Average		
Year Built:	1980		

Adjustments

Hillside Construction:	Degree of Slope: Level	Site Accessibility:	Fair
	Site Position: Unknown	Soil Condition:	Good

Fees

Architect Fees:	7% is included
Overhead and Profit:	20% is included

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

Property Express

FLOOD Replacement Cost Valuation

Policy Number: ESTIMATE-0000891

8/5/2022

SUMMARY OF COSTS		Reconstruction	Exclusion
SUPERSTRUCTURE			
Site Preparation		\$2,745	
Foundations		\$122,913	
Foundation Wall, Interior Foundations, Slab On Ground			
Exterior		\$3,026,207	
Framing, Exterior Wall, Exterior Wall, Structural Floor, Roof			
Interior		\$2,004,844	
Floor Finish, Ceiling Finish, Partitions			
Mechanicals		\$3,938,739	
Heating, Cooling, Fire Protection, Plumbing, Electrical, Elevators			
Built-ins		\$661,218	
SUBTOTAL RC		\$9,756,667	
ADDITIONS			
Building Items		\$574,088	
Total Additions		\$574,088	
TOTAL RC Section 1		\$10,330,754	
TOTAL RC BUILDING 1 Watermark Condominium		\$10,330,754	
	Reconstruction	Sq.Ft.	\$/Sq.Ft.
LOCATION TOTAL, Location 1	\$10,330,754	52,188	\$198
	Reconstruction	Sq.Ft.	\$/Sq.Ft.
VALUATION GRAND TOTAL	\$10,330,754	52,188	\$198

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

Property Express

FLOOD Replacement Cost Valuation

EQUIPMENT REPORT

Policy Number: ESTIMATE-0000891

8/5/2022

VALUATION

Valuation Number:	ESTIMATE-0000891	Effective Date:	08/05/2022
Value Basis:	Reconstruction	Expiration Date:	08/05/2023
		Estimate Expiration Date:	11/03/2022
		Cost as of:	03/2022

BUSINESS

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

LOCATION 1 - Watermark Condominium Association

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

Equipment: Building items and site improvements

	Replacement	Depreciated
Building 1, Section 1		
Building Items		
Balconies		
(1) Balconies, Reinforced concrete frame	\$561,330	\$561,330
Canopies		
(1) Cast-in-Place Concrete w/Flat Plate Deck, Wall supported	\$12,758	\$12,758
LOCATION 1 - Watermark Condominium Association TOTAL	\$574,088	\$574,088
TOTAL	\$574,088	\$574,088

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.

©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.



Valuation Standard Report

Property Express

FLOOD Replacement Cost Valuation

SUMMARY REPORT

Policy Number: ESTIMATE-0000891

8/5/2022

VALUATION

Valuation Number:	ESTIMATE-0000891	Effective Date:	08/05/2022
Value Basis:	Reconstruction	Expiration Date:	08/05/2023
		Estimate Expiration Date:	11/03/2022
		Cost as of:	03/2022

BUSINESS

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

LOCATION 1 - Watermark Condominium Association

Watermark Condominium Association
401 N. Atlantic Ave.
NEW SMYRNA BEACH, FL 32169 USA

BUILDING 1: SUPERSTRUCTURE			Reconstruction	Sq.Ft.	\$/Sq.Ft.
Section 1	100%	Condominium	\$9,756,667	52,188	\$187
Section Totals			Reconstruction	Sq.Ft.	\$/Sq.Ft.
Section 1	100%	Condominium	\$9,756,667	52,188	\$187
Total Additions:			\$574,088		
BUILDING TOTAL, Building 1			\$10,330,754	52,188	\$198

BUILDING INSURANCE SUMMARY

Total Insured Amount	\$0	
Percent of Insurance to Value	0%	
100% Co-insurance Requirement	\$10,330,754	\$10,330,754
-100% Variance	(\$10,330,754)	

	Reconstruction	Sq.Ft.	\$/Sq.Ft.
LOCATION TOTAL, Location 1	\$10,330,754	52,188	\$198

	Reconstruction	Sq.Ft.	\$/Sq.Ft.
VALUATION GRAND TOTAL	\$10,330,754	52,188	\$198



End of Report

CoreLogic costs include labor and material, normal profit and overhead as of date of report. Costs represent general estimates which are not to be considered a detailed quantity survey. These costs include generalities and assumptions that are common to the types of structures represented in the software.

The commercial contents values CoreLogic publishes in this report are estimates only and should not be considered the actual value of commercial contents insurance coverage that should be underwritten for the insured.


©CoreLogic. All rights reserved. CORELOGIC, the CoreLogic Logo, Commercial Express, and Commercial ExpressLync are the property of CoreLogic, Inc.

Watermark Condominium

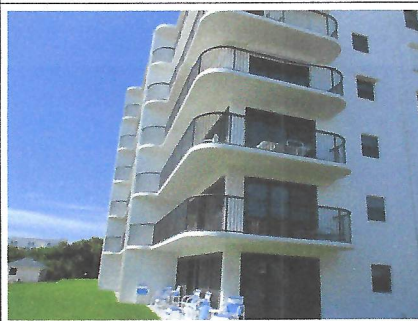
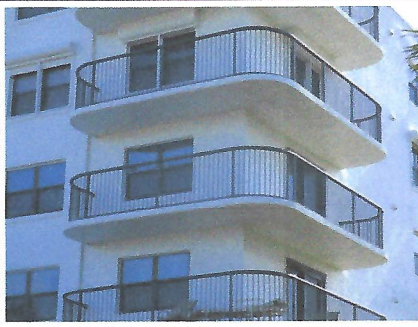






South Garage

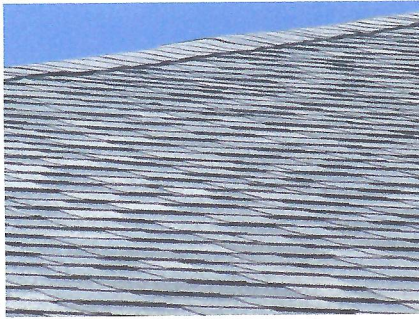


North Garage

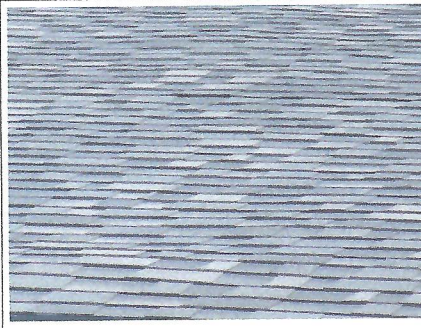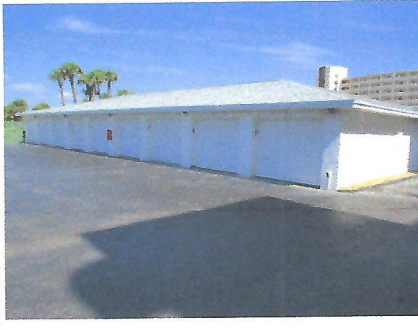

Pool Building

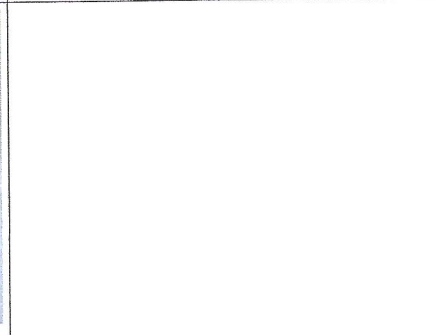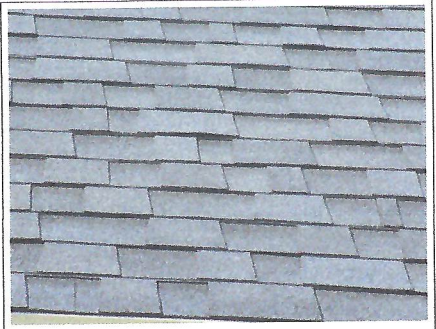

Site Additons

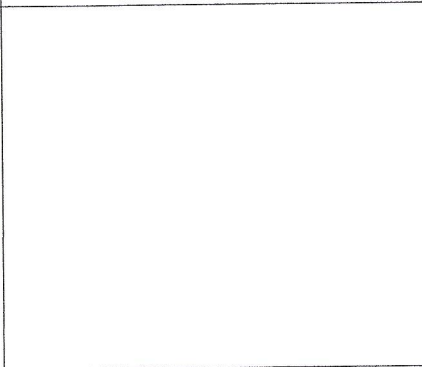

ISO Types 1-6: Construction Code Descriptions

ISO 1 – Frame (combustible walls and/or roof)

Class 1B

Buildings where the exterior walls are wood or other combustible materials, including construction where the combustible materials are combined with other materials such as brick veneer, stone veneer, wood iron-clad and stucco on wood.

Wood frame walls, floors, and roof deck

Brick Veneer, wood/hardiplank siding, stucco cladding

Wood frame roof with wood decking and typical roof covers below:

- *Shingles
- *Clay/concrete tiles
- *BUR (built up roof with gravel or modified bitumen)
- *Single-ply membrane
- *Less Likely metal sheathing covering
- *May be gable, hip, flat or combination of geometries

Roof anchorage

- *Toe nailed
- *Clips
- *Single Wraps
- *Double Wraps

Examples: Primarily Habitational, max 3-4 stories

ISO 2 – Joisted Masonry (JM) (noncombustible masonry walls with wood frame roof)

Class 2B

Buildings where the exterior walls are wood or other combustible materials, including construction where the combustible materials are combined with other materials such as brick veneer, stone veneer, wood iron-clad and stucco on wood.

Concrete block, masonry, or reinforced masonry load bearing exterior walls

*if reported as CB walls only, verify if wood frame (ISO 2) or steel/noncombustible frame roof (ISO 4)

*verify if wood frame walls (Frame ISO 1) or wood framing in roof only (JM ISO 2)

Stucco, brick veneer, painted CB, or EIFS exterior cladding

Floors in multi-story buildings are wood framed/wood deck or can be concrete on wood or steel deck.

Wood frame roof with wood decking and typical roof covers below:

- *Shingles
- *Clay/concrete tiles
- *BUR (built up roof with gravel or modified bitumen)
- *Single-ply membrane
- *Less Likely metal sheathing covering
- *May be gable, hip, flat or combination of geometries

Roof anchorage

- *Toe nailed
- *Clips
- *Single Wraps
- *Double Wraps

Examples: Primarily Habitational, small office/retail, max 3-4 stories

If “tunnel form” construction meaning there is a concrete deck above the top floor ceiling with wood frame roof over the top concrete deck, this will react to wind forces much the same way as typical JM construction. It is slightly better from a fire rating standpoint and from a wind standpoint in terms of potential damage if the wood frame is damaged. Please provide comments in the construction details of SOV for this type of construction.

A subset of JM Construction is Heavy Timber Joisted Masonry JM Class II, also known as ISO 7 (Class 7AB). This is Joisted Masonry constructed buildings where the following additional conditions exist: Where the entire roof has a minimum thickness of 2 inches with Roof Supported by timber and having a minimum dimension of 6 inches, or where the entire roof assembly is documented to have a UL wind uplift classification of 90 or equivalent.

ISO Types 1-6: Construction Code Descriptions

ISO 3 - Non Combustible (NC)

Class 3B / NC-I (non-combustible)

Buildings where the exterior walls and the floors and roof are constructed of and supported by metal, asbestos, gypsum or other non-combustible materials.

Minimal combustible materials in the building construction

Typical steel frame walls with masonry in-fill, brick veneer, metal sheathing, EIFS. Steel framing is load bearing portion of the building frame. AMBS (all metal building system) pre-engineered construction is common. Light steel frame ISO 3 smaller geometry with no interior building support columns. Heavier ISO 3 larger geometries with internal support columns and heavier roof framing. If multi-story, floors are commonly concrete on steel frame on steel deck.

Roof deck and roof cover systems:

*Steel deck

- BUR (built up roof with gravel or modified bitumen)
- Single-ply membrane
- Lesser extent foam/spray applied roof which is typically applied over an existing roof cover – this is not considered a roof cover replacement.
- Usually flat/low sloped

*Metal

- Lap seam metal panel (exposed fasteners)
- Standing seam metal panel (concealed fasteners)
- May or may not be coated/sealed
- May be gable, hip, flat or combination of geometries

Roof anchorage:

*Light steel frame ISO 3 may still incorporate clips, single wraps, or double wraps

*Because of heavier construction with no wood framing in roof, roof to wall anchorage is typically an engineered bolted and/or **structural** roof connection. Toe nailing, Clips, single wraps, double wraps do not apply.

Examples: warehouses, manufacturing facilities

A subset of NC Construction is Superior Non-Combustible Construction NC-II, also known as ISO 8 (Class 8AB). This shall apply to Non-combustible constructed buildings where the following additional conditions exist: Where the entire roof is constructed of 2 inches of masonry on steel supports; or, where the entire roof is constructed of 22 gauge metal (or heavier) on steel supports; or, where the entire roof assembly is documented to have a wind uplift classification of 90 or equivalent.

ISO 4 - Masonry Non Combustible (MNC)

Class 4AB / MNC-I

Buildings where the exterior walls are constructed of masonry materials as described in code 2 above, with the floors and roof of metal or other non-combustible materials.

Concrete block, reinforced masonry, tilt-up concrete load bearing walls – may be combined with some heavy steel framing. Floors commonly concrete on steel deck for multi-story buildings. Roof construction is typically heavy steel frames.

Roof deck and roof cover systems:

*Steel deck with insulation boards (commonly called insulated steel deck roofing system)

- BUR (built up roof with gravel or modified bitumen)
- Single ply membrane
- Lesser extent foam/spray applied roof which is typically applied over an existing roof cover – this is not considered a roof cover replacement.
- Flat/low sloped

*Lightweight insulating concrete or gypsum board on steel deck

- BUR (built up roof with gravel or modified bitumen)
- Single ply membrane
- Lesser extent foam/spray applied roof which is typically applied over an existing roof cover – this is not considered a roof cover replacement.

ISO Types 1-6: Construction Code Descriptions

- Flat/slow slope

- Sometimes possibly heavier concrete on steel deck or precast concrete panels for roof frame may still be considered ISO 4 if exposed steel is not fire proofed to obtain fire ratings needed to be ISO 5.

- *Steel frame with metal sheathing roof cover

- Lap seam metal panel (exposed fasteners)

- Standing seam metal panel (concealed fasteners)

- May or may not be coated/sealed

- May be gable, hip, flat or combination of geometries

Roof anchorage

*Because of heavier construction with no wood framing in roof, roof to wall anchorage is typically an engineered bolted and/or **structural** roof connection. Toe nailing, Clips, single wraps, double wraps do not apply.

Walls have minimum 1 hour fire rating

Examples: shopping centers, strip centers, office buildings, warehouses, schools

A subset of MNC Construction is Superior Masonry Non-Combustible Construction MNC-II, also known as ISO 9 (Class 9A). This shall apply to Masonry Non-combustible constructed buildings where the following additional conditions exist: Where the entire roof is constructed of 2 inches of masonry on steel supports; or, where the entire roof is constructed of 22 gauge metal (or heavier) on steel supports; or, where the entire roof assembly is documented to have wind uplift classification of 90 or equivalent.

ISO 5 - Modified or Semi Fire Resistive (MFR or SFR)

Class 5A

Overall construction of fire resistive materials with fire rating less than 2 hours but greater than 1 hour. Exterior walls, floors and roof deck typically of masonry materials not less than 4 in thick but less thick than required for the 2 hour minimum rating for fire resistive construction.

Protected steel and/or concrete or heavy masonry walls and floors.

Semi wind resistive

Roof deck and roof cover systems

- *Heavy steel frame with concrete poured on steel deck

- BUR (built up roof with gravel or modified bitumen)

- Single ply membrane

- Lesser extent foam/spray applied roof which is typically applied over an existing roof cover – this is not considered a roof cover replacement.

- Flat/low sloped

- Exposed steel must be fireproofed to achieve required fire rating

- *Precast concrete (PC) panels

- BUR (built up roof with gravel or modified bitumen)

- Single ply membrane

- Lesser extent foam/spray applied roof which is typically applied over an existing roof cover – this is not considered a roof cover replacement.

- Flat/low sloped

- *Steel deck with insulation boards, gypsum, lightweight insulating concrete

- BUR (built up roof with gravel or modified bitumen)

- Single ply membrane

- Lesser extent foam/spray applied roof which is typically applied over an existing roof cover – this is not considered a roof cover replacement.

- Flat/low sloped

- Exposed steel must be fire proofed to achieve required fire rating.

Roof anchorage

*Because of heavier construction with no wood framing in roof, roof to wall anchorage is typically an engineered bolted and/or **structural** roof connection. Toe nailing, Clips, single wraps, double wraps do not apply.

Examples: high and mid-rise office buildings and condos

ISO Types 1-6: Construction Code Descriptions

ISO 6 - Fire Resistive (FR)

Class 6A

Fire rating not less than 2 hours for walls, floors, and roofs. This typically requires walls of masonry materials minimum of 4 in thick, hollow masonry minimum 8 in thick, floors and roofs minimum of 4 in thick reinforced concrete, and any structural steel load bearing components with minimum of 2 hour fire rating, Reinforced Concrete Construction building frame and floors and/or very well protected steel and concrete Floors are minimum 4" cast in place concrete, precast concrete or concrete on protected steel

Wind resistive

Precast construction - brought in from elsewhere / Cast in Place is poured on site

Roof deck and roof cover systems

*Cast in place reinforced concrete or precast concrete

-BUR (built up roof with gravel or modified bitumen)

-Single ply membrane

-Lesser extent foam/spray applied roof which is typically applied over an existing roof cover – this is not considered a roof cover replacement

-Flat/low sloped

-In some cases, structural concrete poured on steel deck, but exposed steel must be fireproofed to achieve required minimum 2 hour fire rating

-If exposed concrete, such as on parking deck, leave roof cover as Unknown on SOV. This is typically an exposed or sealed concrete roof deck and the ISO 5 or 6 construction and occupancy will account for the roof deck/cover type. Can provide construction comment on SOV.

Roof anchorage

*Because of heavier construction with no wood framing in roof, roof to wall anchorage is typically an engineered bolted and/or **structural** roof connection. Toe nailing, Clips, single wraps, double wraps do not apply.

Examples: high-rise office buildings and condos, parking garages

Florida Statutes 718.111 (11) Insurance

11) **INSURANCE.**—In order to protect the safety, health, and welfare of the people of the State of Florida and to ensure consistency in the provision of insurance coverage to condominiums and their unit owners, this subsection applies to every residential condominium in the state, regardless of the date of its declaration of condominium. It is the intent of the Legislature to encourage lower or stable insurance premiums for associations described in this subsection.

(a) Adequate property insurance, regardless of any requirement in the declaration of condominium for coverage by the association for full insurable value, **replacement cost, or similar coverage, must be based on the replacement cost of the property to be insured as determined by an independent insurance appraisal or update of a prior appraisal. The replacement cost must be determined at least once every 36 months.**

1. An association or group of associations may provide adequate property insurance through a self-insurance fund that complies with the requirements of ss. [624.460-624.488](#).

2. The association may also provide adequate property insurance coverage for a group of at least three communities created and operating under this chapter, chapter 719, chapter 720, or chapter 721 by obtaining and maintaining for such communities insurance coverage sufficient to cover an amount equal to the probable maximum loss for the communities for a 250-year windstorm event. Such probable maximum loss must be determined through the use of a competent model that has been accepted by the Florida Commission on Hurricane Loss Projection Methodology. A policy or program providing such coverage may not be issued or renewed after July 1, 2008, unless it has been reviewed and approved by the Office of Insurance Regulation. The review and approval must include approval of the policy and related forms pursuant to ss. [627.410](#) and [627.411](#), approval of the rates pursuant to s. [627.062](#), a determination that the loss model approved by the commission was accurately and appropriately applied to the insured structures to determine the 250-year probable maximum loss, and a determination that complete and accurate disclosure of all material provisions is provided to condominium unit owners before execution of the agreement by a condominium association.

3. When determining the adequate amount of property insurance coverage, the association may consider deductibles as determined by this subsection.

(b) If an association is a developer-controlled association, the association shall exercise its best efforts to obtain and maintain insurance as described in paragraph (a). Failure to obtain and maintain adequate property insurance during any period of developer control constitutes a breach of fiduciary responsibility by the developer-appointed members of the board of directors of the association, unless the members can show that despite such failure, they have made their best efforts to maintain the required coverage.

(c) Policies may include deductibles as determined by the board.

1. The deductibles must be consistent with industry standards and prevailing practice for communities of similar size and age, and having similar construction and facilities in the locale where the condominium property is situated.

2. The deductibles may be based upon available funds, including reserve accounts, or predetermined assessment authority at the time the insurance is obtained.

3. The board shall establish the amount of deductibles based upon the level of available funds and predetermined assessment authority at a meeting of the board in the manner set forth in s. 718.112(2)(e).

(d) An association controlled by unit owners operating as a residential condominium shall use its best efforts to obtain and maintain adequate property insurance to protect the association, the association property, the common elements, and the condominium property that must be insured by the association pursuant to this subsection.

(e) The declaration of condominium as originally recorded, or as amended pursuant to procedures provided therein, may provide that condominium property consisting of freestanding buildings comprised of no more than one building in or on such unit need not be insured by the association if the declaration requires the unit owner to obtain adequate insurance for the condominium property. An association may also obtain and maintain liability insurance for directors and officers, insurance for the benefit of association employees, and flood insurance for common elements, association property, and units.

(f) Every property insurance policy issued or renewed on or after January 1, 2009, for the purpose of protecting the condominium must provide primary coverage for:

1. **All portions of the condominium property as originally installed or replacement of like kind and quality, in accordance with the original plans and specifications.**

2. All alterations or additions made to the condominium property or association property pursuant to s. 718.113(2).

3. **The coverage must exclude all personal property within the unit or limited common elements, and floor, wall, and ceiling coverings, electrical fixtures, appliances, water heaters, water filters, built-in cabinets and countertops, and window treatments, including curtains, drapes, blinds, hardware, and similar window treatment components, or replacements of any of the foregoing which are located within the boundaries of the unit and serve only such unit.** Such property and any insurance thereupon is the responsibility of the unit owner.

(g) A condominium unit owner's policy must conform to the requirements of s. 627.714.

1. All reconstruction work after a property loss must be undertaken by the association except as otherwise authorized in this section. A unit owner may undertake reconstruction work on portions of the unit with the prior written consent of the board of administration. However, such work may be conditioned upon the approval of the repair methods, the qualifications of the proposed contractor, or the contract that is used for that purpose. A unit owner must obtain all required governmental permits and approvals before commencing reconstruction.

2. Unit owners are responsible for the cost of reconstruction of any portions of the condominium property for which the unit owner is required to carry property insurance, and any such reconstruction work undertaken by the association is chargeable to the unit owner and enforceable as an assessment pursuant to s. 718.116.

3. A multicondominium association may elect, by a majority vote of the collective members of the condominiums operated by the association, to operate the condominiums as a single condominium for purposes of insurance matters, including, but not limited to, the purchase of the property insurance required by this section and the apportionment of deductibles and damages in excess of coverage. The election to aggregate the treatment of insurance premiums, deductibles, and excess damages constitutes an amendment to the declaration of all condominiums operated by the association, and the costs of insurance must be stated in the association budget. The amendments must be recorded as required by s. 718.110.

(h) The association shall maintain insurance or fidelity bonding of all persons who control or disburse funds of the association. The insurance policy or fidelity bond must cover the maximum funds that will be in the custody of the association or its management agent at any one time. As used in this paragraph, the term "persons who control or disburse funds of the association" includes, but is not limited to, those individuals authorized to sign checks on behalf of the association, and the president, secretary, and treasurer of the association. The association shall bear the cost of any such bonding.

(i) The association may amend the declaration of condominium without regard to any requirement for approval by mortgagees of amendments affecting insurance requirements for the purpose of conforming the declaration of condominium to the coverage requirements of this subsection.

(j) Any portion of the condominium property that must be insured by the association against property loss pursuant to paragraph (f) which is damaged shall be reconstructed, repaired, or replaced as necessary by the association as a common expense. All property insurance deductibles, uninsured losses, and other damages in excess of property insurance coverage under the property insurance policies maintained by the association are a common expense of the condominium, except that:

1. A unit owner is responsible for the costs of repair or replacement of any portion of the condominium property not paid by insurance proceeds if such damage is caused by intentional conduct, negligence, or failure to comply with the terms of the declaration or the rules of the association by a unit owner, the members of his or her family, unit occupants, tenants, guests, or invitees, without compromise of the subrogation rights of the insurer.

2. The provisions of subparagraph 1. regarding the financial responsibility of a unit owner for the costs of repairing or replacing other portions of the condominium property also apply to the costs of repair or replacement of personal property of other unit owners or the association, as well as other property, whether real or personal, which the unit owners are required to insure.

3. To the extent the cost of repair or reconstruction for which the unit owner is responsible under this paragraph is reimbursed to the association by insurance proceeds, and the association has collected the cost of such repair or reconstruction from the unit owner, the association shall reimburse the unit owner without the waiver of any rights of subrogation.

4. The association is not obligated to pay for reconstruction or repairs of property losses as a common expense if the property losses were known or should have been known to a unit owner and were not reported to the association until after the insurance claim of the association for that property was settled or resolved with finality, or denied because it was untimely filed.

(k) An association may, upon the approval of a majority of the total voting interests in the association, opt out of the provisions of paragraph (j) for the allocation of repair or reconstruction expenses and allocate repair or reconstruction expenses in the manner provided in the declaration as originally recorded or as amended. Such vote may be approved by the voting interests of the association without regard to any mortgagee consent requirements.

(l) In a multicondominium association that has not consolidated its financial operations under subsection (6), any condominium operated by the association may opt out of the provisions of paragraph (j) with the approval of a majority of the total voting interests in that condominium. Such vote may be approved by the voting interests without regard to any mortgagee consent requirements.

(m) Any association or condominium voting to opt out of the guidelines for repair or reconstruction expenses as described in paragraph (j) must record a notice setting forth the date of the opt-out vote and the page of the official records book on which the declaration is recorded. The decision to opt out is effective upon the date of recording of the notice in the public records by the association. An association that has voted to opt out of paragraph (j) may reverse that decision by the same vote required in paragraphs (k) and (l), and notice thereof shall be recorded in the official records.

(n) The association is not obligated to pay for any reconstruction or repair expenses due to property loss to any improvements installed by a current or former owner of the unit or by the developer if the improvement benefits only the unit for which it was installed and is not part of the standard improvements installed by the developer on all units as part of original construction, whether or not such improvement is located within the unit. This paragraph does not relieve any party of its obligations regarding recovery due under any insurance implemented specifically for such improvements.

(o) The provisions of this subsection shall not apply to timeshare condominium associations. Insurance for timeshare condominium associations shall be maintained pursuant to s. 721.165.

Property & Wind Storm Insurance Liability Table

Identifies which party (Unit Owner or Association) is responsible for insurance coverage per State of Florida Statute 718

<u>BUILDING ELEMENT TO BE INSURED</u>	<u>UNIT OWNER</u>	<u>ASSOCIATION</u>
VERTICAL WALLS:		
Exterior:		
Mesh, Lath, Sheathing, Glass, Block, Stucco (Painted)		X
Studs & Insulation		X
Unfinished Sheet Rock (Drywall)		X
Interior Wall area of exterior wall (wall coverings)	X	
Interior Unit Walls (including party walls)		
Block, Studs & Insulation		X
Unfinished Sheet Rock (Drywall)		X
Interior Wall Treatments (paint, tile, wallpaper)	X	
Common Area Interior Walls		
Block, Studs & Insulation		X
Unfinished Sheet Rock (Drywall)		X
Interior Wall Treatments (paint, tile, wallpaper)		X
HORIZONTAL WALLS (including ceilings):		
Interior Unit Floors		
Concrete, Framing, Insulation, Plywood.		X
Floor Coverings	X	
Common Area Floors		
Concrete, Framing, Insulation, Plywood.		X
Floor Coverings		X
Interior Unit Ceilings & Roof Area		
Concrete, Framing, Plywood, Insulation, Sheet rock		X
Paint and/or Texture Finish (popcorn, spackling, etc)	X	
Common Area Ceilings & Roof Area		
Concrete, Framing, Plywood, Insulation, Sheet rock		X
Paint and/or Texture Finish (popcorn, spackling, etc)		X
ROOFING (interior units & common areas):		
All Framing, Supports, Deckings, Insulation & Covering		X
UNIT INTERIOR FINISHES:		
Electrical Fixtures, Appliances, Air Handlers, Water Heaters & Cabinets	X	



(866) 480-8236

Flood Insurance Liability Table

Identifies which party (Unit Owner or Association) is responsible for flood insurance coverage per the National Flood Insurance Program guidelines.

<u>BUILDING ELEMENT TO BE INSURED</u>	<u>UNIT OWNER</u>	<u>ASSOCIATION</u>
VERTICAL WALLS:		
Exterior:		
Mesh, Lath, Sheathing, Glass, Block, Stucco (Painted)		X
Studs & Insulation		X
Unfinished Sheet Rock (Drywall)		X
Interior Wall area of exterior wall (wall coverings)		X
Interior Unit Walls (including party walls)		
Block, Studs & Insulation		X
Unfinished Sheet Rock (Drywall)		X
Interior Wall Treatments (paint, tile, wallpaper)		X
Common Area Interior Walls		
Block, Studs & Insulation		X
Unfinished Sheet Rock (Drywall)		X
Interior Wall Treatments (paint, tile, wallpaper)		X
HORIZONTAL WALLS (including ceilings):		
Interior Unit Floors		
Concrete, Framing, Insulation, Plywood.		X
Floor Coverings		X
Common Area Floors		
Concrete, Framing, Insulation, Plywood.		X
Floor Coverings		X
Interior Unit Ceilings & Roof Area		
Concrete, Framing, Plywood, Insulation, Sheet rock		X
Paint and/or Texture Finish (popcorn, spackling, etc)		X
Common Area Ceilings & Roof Area		
Concrete, Framing, Plywood, Insulation, Sheet rock		X
Paint and/or Texture Finish (popcorn, spackling, etc)		X
ROOFING (interior units & common areas):		
All Framing, Supports, Deckings, Insulation & Covering		X
UNIT INTERIOR FINISHES:		
Electrical Fixtures, Appliances, Air Handlers, Water Heaters & Cabinets		X



(866) 480-8236

About Expert Inspectors , Inc.

Expert Inspectors has been conducting replacement cost valuations (insurance appraisals) since 2002. We are and have always been a family owned and operated company. We pride ourselves on offering the very best professional and personalized service to our client associations. Over the years Expert has had the honor to service the needs of thousands of associations, homeowners & commercial property owners.

Expert Inspectors is fully licensed and insured. All of our personnel are highly trained and fully certified for the duties that they perform.

Dave Kolodzik, PPIA, CRVS President



Dave Kolodzik has been conducting Replacement Cost Valuations on associations since 2002. He has completed literally thousands of Insurance Appraisals for commercial buildings, homes as well as condominium & homeowner associations.

Dave is a former licensed All-Lines Insurance Adjuster with the PPIA (Professional Property Insurance Adjuster) designation as well as a Certified Replacement Valuation Specialist (CRVS). He is also certified by the State of Florida as a Continuing Education Provider teaching Replacement Cost Valuation classes.

All aspects of every replacement cost valuation conducted by Expert Inspectors are personally conducted or supervised by Dave. No large international corporate atmosphere. No boiler plated one size fits all inspection and valuation. We offer our clients true individual professional and personal service. Every replacement cost valuation is produced to the individual needs of the each association.

Client Promise

Expert Inspectors takes our commitment seriously & appreciates the confidence and faith that our clients place in us. To that end we make the following promise:

1. We will strive to provide you with the professional and personalized service that you deserve at a competitive price.
2. The on-site Specialist will be the person who processes your report. No having to deal with several different people who ask you the same questions over and over.
3. The Specialist who is assigned to your Association will be thoroughly trained and certified to conduct both the on-site visit as well as process your report.
4. All emails and phone calls will be returned within one (1) business day by either the Specialist assigned to you or by a corporate officer of Expert Inspectors. Our clients are far too important to have their questions or concerns put off or ignored. We will make sure the person who contacts you back will either have an answer for you or will be in a position to provide you with one quickly.



The Power of
PROPERTY INTELLIGENCE

Certificate Of Award

THIS IS TO CERTIFY THAT

David E. Kolodzik

Has Been Awarded The Designation Of

Certified Replacement Valuation Specialist (CRVS)

In The Following Categories

Commercial

Building Valuation System (BVS)

Residential

Residential Component Technology (RCT)

Residential Component Technology High Value (RCT-HV)

January 22, 2012

Issued by Marshall & Swift / Boeckh (MSB)



Certificate of Completion


This certifies that the named person has successfully completed the insurance course taught in compliance with the rules of Florida Department of Financial Services.

David Kolodzik

has been awarded the PPIA designation and has successfully completed the following course offered by HurriClaim Training Academy, in partnership with MindCross Training.

*Professional Property Insurance Adjuster (PPIA)
Designation Course*

Completion Date: May 5th, 2018


Rosanne Hutton
School Official

May 07, 2018
Date



Certificate Details

Provider: HurriClaim Training

Course ID: 95344

Offering ID: 1079476

www.mindcross.com
www.wetrainadjusters.com
training@mindcross.com
304.725.2617